



# Technical Information Bulletin

Date: 8/5/2003

## RAF-11 s/n: L1026 and prior

Update of transorbs to diodes for the reception and paper feed roller.

This update reduces the possibility of PLC failure and is strongly recommended by PDI. Part number 001298 Quantity 2.

Paper feed roller has the cathode to wire number 35 and the anode to wire number 13.

Reception solenoid / lateral jogger solenoid attach cathode to wire number 40 and anode to wire number 13 in the location shown in the picture.


Install diodes in locations shown in the following pictures.



Also available are replacement paper pads made from stainless steel, to replace the gray tape paper pads on either side of the stabber. Part number 000332 Quantity 2.



## Diode

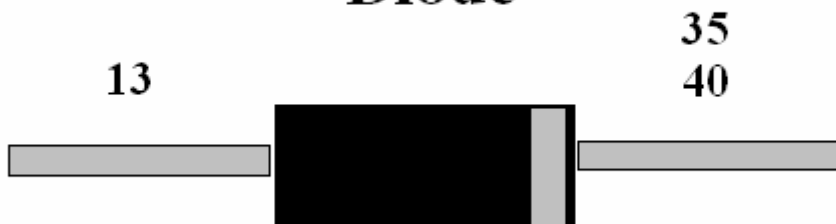

Performance Design 2350 E. Braniff St. Boise, ID. 83716

Phone: 1-800-390-5782 Fax: 1-800-390-5783

Hours: 8:00 AM-5:00 PM Mountain Standard Time